

भारतीय मानक

IS 1196 : 2023

Indian Standard

कोलतार बिटुमेन फर्श बिछाना —
रीति संहिता

(तीसरा पुनरीक्षण)

Laying Bitumen Mastic Flooring —
Code of Practice

(*Third Revision*)

ICS 91.100.50

© BIS 2023



भारतीय मानक ब्यूरो

BUREAU OF INDIAN STANDARDS
मानक भवन, 9 बहादुर शाह ज़फर मार्ग, नई दिल्ली - 110002
MANAK BHAVAN, 9 BAHADUR SHAH ZAFAR MARG
NEW DELHI - 110002

www.bis.gov.in www.standardsbis.in

October 2023

Price Group 6

FOREWORD

This Indian Standard (Third Revision) was adopted by the Bureau of Indian Standards, after the draft finalized by the Flooring, Wall Finishing and Roofing Sectional Committee had been approved by the Civil Engineering Division Council.

This standard was first published in 1958 and subsequently revised in 1968 and 1978. In the second revision of 1978, due weightage was given to international co-ordination among the standards and practices prevailing in different countries in addition to relating it to the practices in the field in this country. This was met by referring to BS CP 204 : 1965 ‘In-situ floor finishes’ issued by the British Standards Institution then.

The Committee felt a need to revise the standard with a view to updating the standard based on experience gained in last four decades. In this revision, the following major changes have been incorporated:

- a) New materials have been added;
- b) Tables on susceptibility of floor finishes to attack and recommended thickness of mastic have been modified;
- c) Clause on isolating and re-melting has been modified; and
- d) New clauses for construction joints and precaution for laying have been added.

The composition of the Committee responsible for the formulation of this standard is given in Annex A.

This standard contributes to the United Nations Sustainable Development Goal 9 ‘Industry, innovation and infrastructure’: build resilient infrastructure, promote inclusive and sustainable industrialization and foster innovation.

For the purpose of deciding whether a particular requirement of this standard is complied with the final value, observed or calculated, expressing the result of a test or analysis shall be rounded off in accordance with IS 2 : 2022 ‘Rules for rounding off numerical values (*second revision*)’. The number of significant places retained in the rounded off value should be the same as that of the specified value in this standard.

Indian Standard

LAYING BITUMEN MASTIC FLOORING — CODE OF PRACTICE

(Third Revision)

1 SCOPE

1.1 This standard specifies the procedure for laying bitumen mastic flooring and its maintenance.

1.2 This standard does not include provisions of acid resistant bitumen mastic. Details of floor finishes, fixings and adhesives when bitumen mastic is used as a damp-proofing base are not included in this standard.

2 REFERENCES

The standards given below contains provisions, which through reference in this text, constitute the provisions of this standard. At the time of publication, the editions indicated were valid. All standards are subject to revision, and parties to agreements based on this standard are encouraged to investigate the possibility of applying the most recent editions of these standards:

<i>IS No.</i>	<i>Title</i>
IS 334 : 2023	Glossary of terms relating to bitumen and tar (<i>third revision</i>)
IS 702 : 2022	Industrial bitumen — Specification (<i>third revision</i>)
IS 1195 : 2002	Bitumen-mastic for flooring — Specification (<i>third revision</i>)
IS 1322 : 1993	Bitumen felts for water-proofing and damp-proofing — Specification (<i>fourth revision</i>)
IS 7193 : 2013	Glass fibre base bitumen felts — Specification (<i>second revision</i>)

3 TERMINOLOGY

For the purpose of this standard, the definitions given in IS 334 shall apply.

4 GENERAL

4.1 Necessary Information

For efficient planning and execution of flooring work, detailed data and information as given below shall be taken in to account:

- a) The function which the bitumen mastic flooring has to fulfill;

- b) Type of traffic-light, medium or heavy;
- c) Wheeled conveyors, loads and rates of travel, types and widths of wheel or tyre. Crawler mounted vehicles leave permanent indentation on the mastic and can damage the mastic floor with their regular movement;
- d) Weight of standing loads, nature of load and bearing area;
- e) Maximum and minimum temperatures to which the bitumen mastic is to be subjected;
- f) Type of surface finish;
- g) Age, nature and present condition of the base over which the bitumen mastic is to be laid;
- h) Type and thickness of concrete screed to be laid on the base;
- j) Type of underlay, or separating layer, if any;
- k) Space available for plant and means of storing and hoisting materials; and
- m) Any other special requirements.

5 DESIGN CONSIDERATIONS

5.1 Bitumen mastic is dustless, odourless, jointless and impervious to the transmission of moisture, either in liquid or vapour form. The surface is possible to be easily cleaned, to be made noiseless under traffic and resilient. Bitumen mastic is also durable. While it may carry heavy loads, application of concentrated point load may cause indentation. In designing the bitumen mastic flooring consideration shall be given to the anticipated service conditions. Bitumen mastic is, therefore, suitable for a variety of uses under a wide range of climatic and service conditions.

5.1.1 Limitations of Use

The surface of bitumen mastic is liable to become gradually soft ended by prolonged contact with greases, fats and oils. Contamination with such materials shall be avoided.

5.1.2 Susceptibility of bitumen mastic floor finishes to chemical attack is given in Table 1.

Table 1 Susceptibility of Bitumen Mastic Floor Finishes to Chemical and Temperature Attack

(Clause 5.1.2)

Sl No.	Agency	Susceptibility to Attack
(1)	(2)	(3)
i)	Acids and vegetable extracts other than oils	Normal grades of bitumen mastic are subject to attack by acids, but special grades are available to withstand attack by dilute solutions
ii)	Alcoholic liquors	Normal grades of bitumen mastic are subject to attack by certain alcoholic liquors and the use of special grades may be necessary in some situations, for example, breweries and distilleries
iii)	Alkalies	Alkali solutions of low concentration, at normal temperatures, have little or no effect on bitumen mastic. Alkali solutions above 38 °C, particularly of high concentration, will affect bitumen mastic
iv)	Brine (sodium and calcium chloride and sulphate salts)	Under normal conditions, bitumen mastic is unaffected by these agencies
v)	Complex industrial liquids and radio-active materials	Laboratory tests are essential to ensure that a suitable grade of bitumen mastic is used
vi)	Dairy products and milk	Where hygienic conditions are maintained by adequate cleansing, a normal grade is suitable. Where churning of milk cans are handled, it is advisable to incorporate metal armouring in the floor surface, otherwise the floor will become indented and in these areas fats may accumulate and attack the mastic
vii)	Mineral, animal and vegetable oils, fats and greases	Bitumen mastic floor finish is subject to attack by these oils, fats and greases
viii)	Sugar, syrup, sugar solutions, etc	Bitumen mastic is unaffected by dry sugar or solutions of low concentration at normal temperatures. Syrups, molasses and other concentrated solutions will affect bitumen mastic at all temperatures
ix)	Water	Bitumen mastic is unaffected unless frequently in contact with hot water; under such circumstances, a high-temperature grade mastic should be used. Hot and cold water frequently discharged onto the floor may cause cracking. Continuous submergence of bitumen mastic surface under water at any temperature will cause its degradation
x)	Oxidizing agents	Bitumen mastic is not suitable to be used where oxidizing agents are handled

5.2 Thickness

The total thickness to which bitumen mastic should be laid depends upon the traffic conditions to which the flooring will be subjected. Usually the bitumen mastic should be laid in one coat, but two-coat work may be used, depending on the thickness of floor finish. As a general guide the thicknesses as given in Table 2 are recommended.

6 MATERIALS

6.1 Bitumen mastic shall conform to the requirements given in IS 1195.

6.2 Industrial Grade of Bitumen

In case of industrial bitumen, grades 85/25 or 90/15,

meeting the requirements as per IS 702, should be used for bitumen mastic.

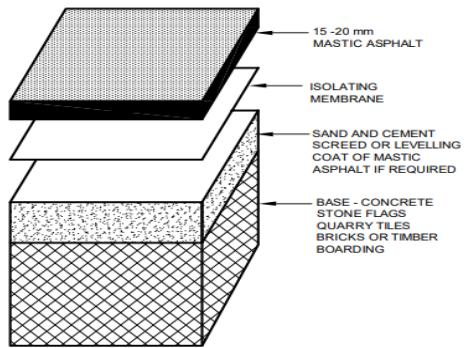
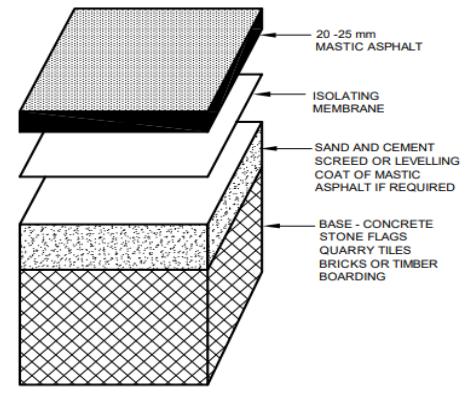
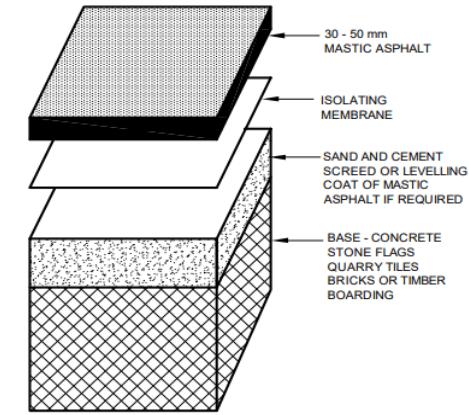
6.3 The bitumen mastic may be delivered to the site either in the form of blocks weighing about 25 kg or in molten condition in a mobile mixer or prepared at the site. Site preparation of the mastic is preferable.

6.4 Surface Armouring

Special types of metal armouring may be incorporated in bitumen mastic flooring for industrial purposes to increase resistance of abrasion.

Table 2 Thickness of Bitumen Mastic for Different Service Conditions

(Clause 5.2)

Sl No.	Examples of Service Conditions	Type of Flooring	Recommended Thickness mm	Suggested Layout of the Flooring
(1)	(2)	(3)	(4)	(5)
i)	Medium wear due to foot traffic	Light duty	15 to 20	 <p>15 -20 mm MASTIC ASPHALT ISOLATING MEMBRANE SAND AND CEMENT SCREED OR LEVELLING COAT OF MASTIC ASPHALT IF REQUIRED BASE - CONCRETE STONE FLAGS QUARRY TILES BRICKS OR TIMBER BOARDING</p>
Example:	Small scale industries, such as those manufacturing electronic and electrical equipment			
ii)	Severe abrasion due to continuous foot traffic	Medium duty	20 to 25	 <p>20 -25 mm MASTIC ASPHALT ISOLATING MEMBRANE SAND AND CEMENT SCREED OR LEVELLING COAT OF MASTIC ASPHALT IF REQUIRED BASE - CONCRETE STONE FLAGS QUARRY TILES BRICKS OR TIMBER BOARDING</p>
Example:	Passenger platforms, footpaths, workshops, etc			
iii)	Severe abrasion combined with impact	Heavy duty	30 to 50	 <p>30 - 50 mm MASTIC ASPHALT ISOLATING MEMBRANE SAND AND CEMENT SCREED OR LEVELLING COAT OF MASTIC ASPHALT IF REQUIRED BASE - CONCRETE STONE FLAGS QUARRY TILES BRICKS OR TIMBER BOARDING</p>
Example:	Heavy engineering, workshops, despatch yards, loading docks, goods platforms, loading platforms for trucks carrying milk bottles in dairy, etc			

7 EQUIPMENT

The equipment shall consist of a bitumen boiler, a mechanically agitated mixer called mastic cooker and other accessories. The equipment shall be set up as near the site of work as possible so as to avoid cooling of the molten material.

8 CONSTRUCTION

8.1 The base on which the bitumen mastic flooring is to be laid shall be adequately strong to receive the mastic and to carry the anticipated traffic over it.

8.2 Preparation of the Base

The base shall have a true, even and dry surface which has been slightly coarsened by means of a stiff broom or wire brush and should be free from ridges and hollows. A steel trowelled finish is not desirable. The levels of the base should be such that the specified thickness of bitumen mastic may be applied uniformly. If the finished floor is likely to have water or industrial liquids upon it, a straight fall of not less than 1 in 75 should be provided. Channels in the mastic layer should be avoided.

8.3 Treatment of the Base

The treatment of the base shall be decided by the designer in consultation with those responsible for the flooring. One of the following may be used:

- A screeded bed of cement concrete or lime concrete not less than 25 mm thick; or
- An isolating membrane or underlay (see 8.4); or
- On metal or concrete floors, a thin priming coat of bitumen should be applied over a clean and dry surface.

8.4 Isolating Membrane

An isolating membrane may be provided to isolate the mastic asphalt from the base to allow for any relative movement between them. It also helps to prevent the formation of blisters and ‘blowing’ of asphalt.

An isolating membrane conforming to Type 1 of IS 1322 is normally used where bitumen mastic up to 20 mm in thickness is laid. Where the base is in direct contact with the ground, glass fibre felt (see IS 7193) may be used as an alternative.

Thickness of bitumen mastic exceeding 20 mm on new concrete are usually laid without an isolating membrane except in circumstances described in (b) below. Isolating membranes should be laid loose.

- An isolating membrane is essential:
 - On a timber base;
 - On a base of porous or open texture, such as no-fines or light-weight concrete;

- Where the concrete surfaces contains fine cracks;
- On a concrete base which has received a surface treatment, such as sodium silicate solution;
- When concrete has been contaminated by foreign matter from industrial processes, such as oils, greases, sugar solutions or chemicals; and
- When the mastic is to be laid over a thermal insulating medium, for example, in cold stores.

- An isolating membrane may also be found necessary in circumstances arising immediately before or at the time of laying, such as the following:

- when the bitumen mastic cools too rapidly to allow it to be handled and properly finished. Premature cooling may be caused by the dissipation of heat through the base or by weather conditions, or both. It may also occur when it is necessary to transport the material far from the cauldron or mixer. Under these conditions, an isolating membrane may act as a thermal insulating medium to assist the retention of heat for a longer time after laying.

8.5 Placing the Isolating Membrane

The isolating membrane, when required should be laid loose with lapped joints.

8.6 Setting Out

The setting out of the floor area into bays is normally decided according to workable requirements. The arrangement of the bays depends upon the design of the floor and the number of spreaders engaged, so that the laying and finishing processes may both be easily controlled by the operatives.

8.7 Re-melting at Site

Re-melting is the term applied to the melting at the site or in a mobile mixer of the pieces of broken bitumen mastic blocks. The blocks shall be broken to convenient size not exceeding 60 mm cubes and loaded into the mechanically agitated mixer or mastic cooker at the site of work. The material shall then be carefully re-melted. At this stage any coarse aggregate preferably preheated shall be fed in successive portions until the complete charge is thoroughly incorporated. After all the coarse aggregate has been incorporated, the material shall be mixed continuously for a period of not less than one hour before laying is begun, and mixing shall be continued until laying operation is completed, so as to maintain the coarse aggregate in suspension. At

no stage during the re-melting and mixing process, shall the temperature exceed 205 °C.

Re-melting of mastic should be normally avoided at site. However, if it becomes necessary for re-melting, it will be carried out under standard procedure as stated above only after taking prior approval from the statutory authority/site in-charge who will carefully and critically examine the necessity of re-melting and will allow re-melting only after convincing justification.

8.8 Laying

8.8.1 Transport of Molten Material

When the material is sufficiently molten to be workable, it should be carried in flat mortar pans, to the point of laying. To prevent the molten material from sticking to the pans they may be sprinkled inside with a minimum quantity of inorganic dust, such as limestone dust, cement, ash etc. Oil shall not be used.

8.8.2 Spreading

Bitumen mastic should generally be laid in bays in one coat. It should be spread to the specified thickness by means of suitable hand tools, gauges, straight edges and hand levels being used to ensure accuracy. The bitumen mastic should then be floated to a uniformly level surface by a heavy wooden float and should be free from roughness and imperfections.

8.8.2.1 If 'blowing' occurs, the bubbles should be punctured and the area affected carefully made good while the mastic is still hot.

8.8.2.2 Two-coat work should be treated in a manner similar to that for single-coat work, but care should be taken to arrange that the joints in successive layers are staggered.

8.8.3 Surface Finish

The type of surface finish required should be specified by the designer. The following are the two types:

- a) Matt finish — The surface should be rubbed in with sand during the final floating operation. The sand should be clean and free from foreign matter. All surplus material should be removed after rubbing is completed, and
- b) Polished finish — The surface should be finished with a float in a manner similar to that used for a matt finish but without the use of an abrasive.

8.8.3.1 Immediately after completion of the laying, the bitumen mastic should be protected from damage till the material cools to the surrounding temperature.

8.8.4 Slipperiness

Bitumen mastic has reasonable slip-resistance, but frequent polishing tends to make it slippery. Where mastic is used as paving to stairs a suitable-non-slip safety nosing or inset should be incorporated in the tread.

8.9 Junctions

Special care should be taken in effecting proper junctions between new and previously laid sections of work. The contact edges of the previously laid mastic should be cleaned and warmed by additional applications of hot mastic. This procedure should also be adopted at junctions between the floor finish and skirtings, coves or fillets.

8.10 Skirtings

Skirtings should be executed in not less than two coats, particular care being taken to ensure proper adhesion of the first coat to the base. Special care should be taken at external angles to ensure the full thickness of the material.

8.11 Protection of the Surface

The newly laid surface should be protected from damage due to careless handling of construction equipment, spillage of oils, paints, chemicals, plying of vehicles, etc. Concrete or mortar shall not be mixed directly on the bitumen mastic surface.

8.12 Construction Joints

Wherever laying of mastic flooring requires to be left half way for its continuation for the next day, it creates a construction joint. Edge of the mastic flooring laid must be chamfered to give it a 45° surface with rough texture. If bitumen appears on the surface, sprinkling of small size coarse aggregates should be done on the surface to create rough texture to confirm necessary interlocking of existing surface with fresh mastic. Warming up of existing chamfered surface before starting next day's work to bring its viscosity close to fresh mastic is preferred.

Additionally, when the floor on which mastic is proposed to be applied is having joints, the viscosity of mastic is to be adjusted such as to make it more flow-able as compared to remaining quantum of mastic.

It is essential to ensure that construction joints of mastic as explained above will not align with the joints of floor on which mastic is to be applied.

8.13 Bringing into Service

The mastic flooring should not be subjected to traffic until the material has cooled throughout to the temperature of the surrounding atmosphere.

9 INSPECTION

The work shall be inspected while in progress and after completion, special attention shall be paid to the following points:

- a) General condition of the base;
- b) Irregular surface of the base and correct laying of the underlay, when used;
- c) Cleanliness of plant for re-melting;
- d) Correct temperature of the mixture prior to laying;
- e) Use of the correct kind of dust to assist removal of mixture from the buckets;
- f) Making good all 'blows';
- g) Correct thickness throughout;
- h) Removal of all asphalt bleed;
- j) Correctness of finished level and specified finish; and
- k) Correct pattern of decorative designs, if any.

10 MAINTENANCE

10.1 Cleaning

The bitumen mastic surface requires relatively little maintenance, though attention is necessary to obtain maximum service. Superficial dirt may normally be removed by washing with warm water and suitable detergents. When hosing down, a constant water temperature should be maintained with the water temperature not exceeding 40 °C. Where there is much dirt on the floor, the addition of a small quantity of washing soda to the warm water may be desirable. After the dirt has been removed the floor should be mopped with clean water. It is essential that all oils, fats and greases spilled on the floor should be removed immediately.

10.2 Repairs

10.2.1 All repair work to a mastic asphalt surface

must be performed by a specialist bitumen mastic contractor.

10.2.2 When a damaged section has to be removed, it should be done carefully. Considerable damage may result from an attempt to cut away an affected area with the hammer and chisel or to soften it with a blowlamp. The correct method is to place hot mastic around and over the area concerned, and after this has had a sufficient softening effect, the area shall be carefully cut away and made good, with fresh bitumen mastic. In no circumstances, should a hammer and chisel be used to cut cold mastic asphalt. An angle grinder may, however, be used as an alternative.

Cutting the damaged mastic in rectangular shape, removing damaged mastic and relaying fresh mastic fulfilling all standard parameters including thickness, temperature, etc is also a standard practice.

10.2.3 When two-coat work is being restored or made good, the edge along the perimeter of the area shall be cut back not less than 75 mm to half the total thickness of the mastic, to form a lapped joint.

11 PRECAUTIONS FOR LAYING

11.1 Mastic asphalt is liable to be damaged at very low temperatures. So, flooring grades should not be laid in open or unheated buildings when the ambient temperature is below 10 °C or likely to fall below this value subsequent to laying.

11.2 Rapid or uneven cooling caused by draughts of air from external opening must be avoided.

ANNEX A*(Foreword)***COMMITTEE COMPOSITION**

Flooring, Wall Finishing and Roofing Sectional Committee, CED 05

<i>Organization</i>	<i>Representative(s)</i>
In Personal Capacity (<i>L/109, Sarita Vihar, New Delhi - 110076</i>)	SHRI ASHOK KHURANA (Chairperson)
Acropolis Institute of Technology and Research, Indore	DR SATISH KUMAR SHARMA SHRI JAYANT AWASTHY (<i>Alternate I</i>) SHRI DEEPSHIKA SHUKLA (<i>Alternate II</i>)
Aludecor Lamination Pvt Ltd, Kolkata	SHRI DEVESH KUMAR
Ardex Endura India Pvt Ltd, Bengaluru	SHRI K. P. PAULSON SHRI GOPINATH KRISHNAN (<i>Alternate</i>)
Central Public Works Department, New Delhi	SHRI A. K. SHARMA MS NANDINI MUKHOPADHYAY (<i>Alternate</i>)
Choksi Laboratories Limited, Indore	SHRI VYANGESH CHOKSI
Construction Industry Development Council, New Delhi	SHRI P. R. SWARUP SHRI RAVI JAIN (<i>Alternate</i>)
CSIR - Central Building Research Institute, Roorkee	SHRI S. K. SINGH DR ACHAL KUMAR MITTAL (<i>Alternate</i>)
CSIR - Central Glass and Ceramic Research Institute, Kolkata	DR PARAG MANGALBHAI SOLANKI DR PARVESH AGARWAL (<i>Alternate I</i>) DR ASHA T. ANIL (<i>Alternate II</i>)
CSIR - Central Road Research Institute, New Delhi	DR RAKESH KUMAR
Delhi Development Authority, New Delhi	CHIEF ENGINEER (DWK) SUPERINTENDING ENGINEER (P) (<i>Alternate</i>)
Engineers India Limited, New Delhi	SHRI SAMIR DAS SHRI AKHILESH MAURYA (<i>Alternate I</i>) SHRI ANISH MAHALA (<i>Alternate II</i>)
H. R. Johnson (India) Limited, Dewas	SHRI SUDIPTA SAHA SHRI SUBHASHISH MUKHOPADHYAY (<i>Alternate</i>)
Indian Council of Ceramic Tiles & Sanitaryware, Mumbai	SHRI SUDIPTA SAHA SHRI P. K. SHARMA (<i>Alternate</i>)

<i>Organization</i>	<i>Representative(s)</i>
Indian Institute of Technology Gandhinagar	DR GAURAV SRIVASTAVA
MAPEI Construction Products India Pvt Ltd, Bengaluru	SHRI HANUMANTHA RAJU S. N. SHRI RAVI JAGTAP (<i>Alternate I</i>) SHRI ASHUTOSH KANDWAL (<i>Alternate II</i>)
Military Engineer Services, Engineer-in-Chief's Branch, Integrated HQ of MoD (Army), New Delhi	SHRIMATI RIVOON MAHENDRU SHRIMATI REMIKA SHARMA (<i>Alternate</i>)
Morbi Dhuva Glaze Tiles Association, Morbi	SHRI NILESH JETPARIA SHRI JERAM MADHAV KAVAR (<i>Alternate</i>)
MYK Laticrete India, Hyderabad	DR P. ARJUNAN SHRI N. RADHAKANTH (<i>Alternate</i>)
National Council for Cement and Building Materials, Ballabgarh	SHRI AMIT TRIVEDI SHRI SANJAY MUNDRA (<i>Alternate I</i>) SHRI AMIT SAGAR (<i>Alternate II</i>)
National Test House, Kolkata	SHRI D. V. S. PRASAD DR SOMIT NEOGI (<i>Alternate</i>)
NTC Tiles LLP, Panchkula	SHRI PREM CHAND GUPTA SHRI SUSHANT GUPTA (<i>Alternate</i>)
Paver and Block Manufacturers Association, Mumbai	SHRI VIJAY KUMBHANI SHRI MEHUL JAIN (<i>Alternate</i>)
Plastindia Foundation, Mumbai	SHRI ARVIND GOENKA DR E. SUNDARESAN (<i>Alternate</i>)
Premier Polyfilm Ltd, Ghaziabad	SHRI PRAVEEN KUMAR SHRI HARENDRA KUMAR (<i>Alternate</i>)
Research Designs and Standards Organization, Lucknow	EXECUTIVE DIRECTOR (WORKS) SHRI ASHUTOSH KUMAR (<i>Alternate</i>)
RMG Polyvinyl India Limited, Ghaziabad	SHRI ASHISH MOHAN SHRI A. N. SINGH (<i>Alternate</i>)
Shriram Institute of Industrial Research, New Delhi	SHRI MUKESH GARG SHRI RAMAN DHYANI (<i>Alternate</i>)
Steuler Industrial Solution (India) Private Limited	SHRI CHIRAG K BAXI SHRI BHARATBHAI D. PATEL (<i>Alternate</i>)
In Personal Capacity (N96, Ground Floor, Mayfield Garden, Sector-51, Gurugram - 122018)	SHRI R. D. MATHUR

<i>Organization</i>	<i>Representative(s)</i>
BIS Directorate General	SHRI ARUNKUMAR S., SCIENTIST 'E'/DIRECTOR AND HEAD (CIVIL ENGINEERING) [REPRESENTING DIRECTOR GENERAL (<i>Ex-officio</i>)]

Member Secretaries
SHRI PRADEEP SINGH SHEKHAWAT
SCIENTIST 'D'/JOINT DIRECTOR
(CIVIL ENGINEERING), BIS
AND
SHRI ABHISHEK PAL
SCIENTIST 'D'/JOINT DIRECTOR
(CIVIL ENGINEERING), BIS

Bureau of Indian Standards

BIS is a statutory institution established under the *Bureau of Indian Standards Act, 2016* to promote harmonious development of the activities of standardization, marking and quality certification of goods and attending to connected matters in the country.

Copyright

BIS has the copyright of all its publications. No part of these publications may be reproduced in any form without the prior permission in writing of BIS. This does not preclude the free use, in the course of implementing the standard, of necessary details, such as symbols and sizes, type or grade designations. Enquiries relating to copyright be addressed to the Head (Publication & Sales), BIS.

Review of Indian Standards

Amendments are issued to standards as the need arises on the basis of comments. Standards are also reviewed periodically; a standard along with amendments is reaffirmed when such review indicates that no changes are needed; if the review indicates that changes are needed, it is taken up for revision. Users of Indian Standards should ascertain that they are in possession of the latest amendments or edition by referring to the website- www.bis.gov.in or www.standardsbis.in.

This Indian Standard has been developed from Doc No.:CED 05 (21199).

Amendments Issued Since Publication

Amend No.	Date of Issue	Text Affected

BUREAU OF INDIAN STANDARDS

Headquarters:

Manak Bhavan, 9 Bahadur Shah Zafar Marg, New Delhi 110002
Telephones: 2323 0131, 2323 3375, 2323 9402

Website: www.bis.gov.in

Regional Offices:

Central : 601/A, Konnectus Tower -1, 6 th Floor, DMRC Building, Bhavbhuti Marg, New Delhi 110002	<i>Telephones</i> 2323 7617
Eastern : 8 th Floor, Plot No 7/7 & 7/8, CP Block, Sector V, Salt Lake, Kolkata, West Bengal 700091	 2367 0012 2320 9474
Northern : Plot No. 4-A, Sector 27-B, Madhya Marg, Chandigarh 160019	 265 9930
Southern : C.I.T. Campus, IV Cross Road, Taramani, Chennai 600113	 2254 1442 2254 1216
Western : Plot No. E-9, Road No.-8, MIDC, Andheri (East), Mumbai 400093	 2821 8093

Branches : AHMEDABAD. BENGALURU. BHOPAL. BHUBANESHWAR. CHANDIGARH. CHENNAI.
COIMBATORE. DEHRADUN. DELHI. FARIDABAD. GHAZIABAD. GUWAHATI.
HIMACHAL PRADESH. HUBLI. HYDERABAD. JAIPUR. JAMMU & KASHMIR.
JAMSHEDPUR. KOCHI. KOLKATA. LUCKNOW. MADURAI. MUMBAI. NAGPUR.
NOIDA. PANIPAT. PATNA. PUNE. RAIPUR. RAJKOT. SURAT. VISAKHAPATNAM.